# Home Inspection



123 Main St Anywhere, USA 12345

Prepared for: Happy Homeowner

Prepared by: Blue Crab Inspections



# Marginal Summary

This summary is not the entire report. The complete report may include additional information of concern to the client. It is recommended that the client read the complete report.

#### Roof

1. Main Roof Surface Material: Asphalt shingle - Roof shows signs of deterioration. A qualified roofing contractor is recommended to evaluate and estimate repairs





2. Downspouts: Metal - Loose, recommend securing



#### Lots and Grounds

3. Deck: Present - Railing is loose, a qualified contractor is recommended to evaluate and estimate repairs



4. Grading: Negative slope - Improper soil slope towards foundation, recommend improving grade to move water away from the house.



5. Vegetation: Shrubs, Trees - Recommend shrubs be cut back a minimum of six inches away from the house structure.





## Marginal Summary (Continued)

## **Exterior Surface and Components**

6. Type: Vinyl siding - Recommend filling all gaps and cracks through out exterior of home to prevent moisture penetration. Recommend monitoring all exterior caulking.



7. Trim: Composite material - Soft wood present. A qualified contractor is recommended to evaluate and estimate repairs






#### Air Conditioning

8. Rear AC System A/C System Operation: Not Tested - At the time of inspection, the AC system was not operated. Outside temperatures were below 60 degrees. Operating the AC unit under these circumstances could lead to compressor damage. Recommend a qualified contractor inspect and operate the entire AC unit before normal use and operation.



#### Plumbing

9. Fuel Lines: Corrugated Stainless Steel Tubing (CSST) - The state requires that bonding for CSST gas line be evaluated by licensed master electrician

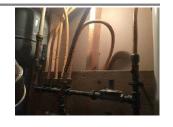

#### Bathroom

10. Master Bedroom Bathroom Shower: Present - Door sticks when trying to open/close. Recommend adjustment





# Marginal Summary (Continued)

11. Master Bedroom Bathroom Toilets: Present - The tank is loose, recommend securing to prevent movement



#### Bedroom

12. 3rd Floor, Front, Right Bedroom Walls: Paint - Signs of repair to drywall throughout house. recommend following up with seller.







Living Space

13. 1st Floor, Family Room Living Space Doors: Wood - Replace missing door stop



#### Attic

14. Main Attic Wiring/Lighting: Light(s) - Light did not function at time of inspection. Recommend replacing bulb and re-testing.



14:55 January 06, 2018

Happy Homeowner 123 Main St Page 4 of 22



## **Defective Summary**

This summary is not the entire report. The complete report may include additional information of concern to the client. It is recommended that the client read the complete report.

#### Electrical

1. Carbon Monoxide Detectors: Not Present - Due to the presence of gas appliances, it is recommended you install carbon monoxide detectors on all levels.



#### Kitchen

2. 2nd Floor Kitchen Dishwasher: Present - Dishwasher is leaking and discharging through airgap. A qualified contractor is recommended to evaluate and estimate repairs





14:55 January 06, 2018

Happy Homeowner 123 Main St Page 5 of 22



## **Table of Contents**

Definitions	6
General Information	6
Roof	7
Lots and Grounds	8
Exterior Surface and Components	9
Air Conditioning	10
Electrical	11
Heating System	12
Plumbing	12
Structure	13
Laundry Room/Area	14
Kitchen	14
Fireplace/Stove	15
Garage	16
Bathroom	16
Bedroom	18
Living Space	19
Attic	21

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 6 of 22



## Definitions

NOTE: All definitions listed below refer to the property or item listed as inspected on this report at the time of inspection

A Acceptable Functional with no obvious signs of defect.

NP Not Present Item not present or not found.

NI Not Inspected Item was unable to be inspected for safety reasons or due to lack of power, inaccessible, or disconnected at

time of inspection.

M Marginal Item is not fully functional and requires repair or servicing.

D Defective Item needs immediate repair or replacement. It is unable to perform its intended function.

## **General Information**

#### **Property Information**

Property Address 123 Main St City Anywhere State USA Zip 12345 Contact Name Number One Realtor

#### Client Information

Client Name Happy Homeowner

Phone (443) 123-4567

E-Mail Happy Homeowner@email.com

#### **Inspection Company**

Inspector Name Scott Cottrell

Company Name Blue Crab Inspections E-Mail inspector@bluecrabinspections.com

License Number 31131

#### Conditions

Others Present Seller, Buyer, Buyer's Agent Property Occupied Occupied

Estimated Age 2006 Entrance Faces Northeast

Inspection Date 01/03/2018

Start Time 3:00 PM End Time 5:45 PM

Electric On • Yes O No O Not Applicable

Gas/Oil On 

Yes O No O Not Applicable

Water On • Yes O No O Not Applicable

Temperature 30 Degrees F

Weather Sunny Soil Conditions Frozen

Space Below Grade None

Water Source Public How Verified Visual Inspection

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 7 of 22



#### Roof

The foregoing is an opinion of the general quality and condition of the roofing material. The inspector cannot and does not offer an opinion or

warranty as to whether the roof leaks or may be subject to future leakage. This report is issued in consideration of the forgoing disclaimer. The only way to determine whether a roof is absolutely watertight is to observe it during a prolonged rainfall. Many times, this situation is not present during the inspection. Chimney flue inspection is limited due to height. The inspection covers only the visible portion of the flue.

A NPNI M D

Main Doof Curfoca
Main Roof Surface —
1. Method of Inspection: Ground level with Binoculars
2. Material: Asphalt shingle - Roof shows signs of deterioration. A qualified roofing contractor is
recommended to evaluate and estimate repairs
3 Type: Gable

s. Type. Gable	
4. Approximate	e Age: 2006
5.	Flashing: Metal
6. 🛛 🗌 🔲 🖺	☐ Valleys: Closed
7. 🗌 🛛 🔲 🔲 🖸	☐ Skylights:
8. 🛛 🗌 🗆 🖸	☐ Electrical Mast: Underground utilities
9.	Gutters: Metal

10. Downspouts: Metal - Loose, recommend securing



I1. ⊠□□□□ Leader/Extension: Plast	ic Pipe
-----------------------------------	---------

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 8 of 22



#### Lots and Grounds

This inspection is not intended to address or include any geological conditions or site stability information. For information concerning these

conditions, a geologist or soils engineer should be consulted. Any reference to grade is limited to only areas around the exterior of the foundation or exterior walls. This inspection is visual in nature and does not attempt to determine drainage performance of the site or the condition of any underground piping, including municipal water and sewer service piping or septic systems. Decks and porches are often built close to the ground. Wood sidings should be a minimum of 6" above ground. Detection of the presence of concealed moisture, mold or wood decay present behind exterior finishes is beyond the scope of this inspection. Promote positive (+) drainage away from foundation and extend runoff from roofing and downspouts a minimum 6 ft from foundation.

extend ranon from re	oring and downspouts a minimum of thom foundation.	
A NPNI M D		
1. X	Driveway: Present Walks: Present Steps: Porch: Patio:	
6.	Deck: Present - Railing is loose, a qualified contractor is recommended to evaluate and estimate repairs	
7.	Balcony: Grading: Negative slope - Improper soil slope towards foundation, recommend improving grade to move water away from the house.	
9.	Vegetation: Shrubs, Trees - Recommend shrubs be cut back a minimum of six inches away from the house structure.	
10. \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	Window Wells: Retaining Walls: Fences: Present	

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 9 of 22



## **Exterior Surface and Components**

Areas hidden from view by finished walls or stored items cannot be evaluated and are not a part of this inspection. Minor cracks are typical in

many foundations and most do not represent a structural problem. If major cracks are present along with bowing, we routinely recommend

further evaluation be made by a qualified structural engineer. All exterior grades should allow for surface and roof water to flow away from

the foundation. All concrete floor slabs experience some degree of cracking due to shrinkage in the drying process.

A NPNI M D	
1.	Type: Vinyl siding - Recommend filling all gaps and cracks through out exterior of home to prevent moisture penetration. Recommend monitoring all exterior caulking.
2.	Trim: Composite material - Soft wood present. A qualified contractor is recommended to evaluate and estimate repairs

3.	$\boxtimes \Box$			Fascia: Composite material
4.	$\boxtimes \Box$			Soffits: Vinyl
5.	$\boxtimes \Box$	]		Door Bell: Present
6.	$\boxtimes \Box$			Windows: Vinyl
7.	$\boxtimes \Box$			Window Screens: Present
8.	$\boxtimes \Box$			Exterior Lighting: Present
9.	$\boxtimes \Box$			Exterior Electric: GFCI
0.	$\boxtimes \Box$			Hose Bibs: Present
1.	$\boxtimes \Box$			Gas Meter: Exterior
2.	$\square$	$\sqcap$		Fuel Shut Off: At Meter

1

14:55 January 06, 2018



Happy Homeowner 123 Main St Page 10 of 22

## Air Conditioning

Mechanical equipment tested for functional operation at time of inspection only. No life expectancy is expressed or implied. Inspection does not determine balancing or sizing of system. The inspection covers only the visible components of the cooling system. Hidden problems may exist that are not documented in this report. The inspector does not perform pressure tests on coolant systems; therefore no representation is made regarding coolant charge or line integrity. Subjective judgment of system capacity is not a part of the inspection. Normal service and maintenance is recommended on a yearly basis. Determining the condition of oil tanks, whether exposed or buried, is beyond the scope of this inspection. Leaking oil tanks represent an environmental hazard, which is sometimes costly to remedy. Any appliance that is being conveyed as part of the purchase transaction of the house should be tested at the final walk through. The appliances estimated for replacement probability, based on age and condition, should be budgeted for replacement in the short term. It should be clearly understood that all appliances are mechanical systems that can fail at any time, regardless any indicated probability and age.

1. A/C System Operation: Not Tested - At the time of inspection, the AC

A NPNI M D

Rear AC System -

es were below 60 degrees. ces could lead to contractor inspect and and operation.
(

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 11 of 22



#### Electrical

Any electrical repairs attempted by anyone other than a licensed electrician should be approached with caution. The power to the entire house should be turned off prior to beginning any repair efforts, no matter how trivial the repair may seem. Aluminum wiring requires periodic

inspection and maintenance by licensed electrician. Operation of time clock motors is not verified. Inoperative light fixtures often lack bulbs or have dead bulbs installed. Light bulbs are not changed during the inspection, due to time constraints. Smoke detectors are recommended to be located in each Bedroom and one per floor level. They should be tested regularly and replaced every 10 years. Ground Fault Interrupter (GFI) Circuits should be installed in kitchens, bathrooms, basements, garages and outdoor locations. Testing of smoke detectors or alarms, timers, low voltage circuits such as security systems and pet containment systems are beyond the scope of this inspection. According to the International Association of Fire Fighters (IAFF) it is recommend you install a photoelectric smoke alarm versus an ionization smoke alarm.

A NPNI M D

1. Service Size Amps: 200 Volts: 120-240 VAC

2.  X                  Service: Aluminum	
3. XIII 120 VAC Branch Circuits: Copper	
4. 240 VAC Branch Circuits: Copper and aluminum	
5. Aluminum Wiring: Not visible on 120 volt circuits	
6. Onductor Type: Non-metallic sheathed cable	
7. X Ground: Plumbing ground	
8. XIII Smoke Detectors: Present	
9. Carbon Monoxide Detectors: Not Present - Due to the presence of gas	
appliances, it is recommended you install carbon monoxide detectors on	
all levels.	
Garage Electric Panel —	2 North Control of the Control of th
10. Manufacturer: Square D	
11. Maximum Capacity: 200 Amps	
12. Main Breaker Size: 200 Amps	
13. Breakers: Copper and Aluminum	
14. Some Fuses:	
15. AFCI: Present	
16. S GFCI: Not Present	
17. Is the panel bonded? • Yes O No	
17. 13 the parter borided: $\Theta$ 163 $\Theta$ 180	

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 12 of 22



Heating System

Mechanical equipment tested for functional operation at time of inspection only. No life expectancy is expressed or implied. Inspection does not determine balancing or sizing of system. The inspection covers only the visible components of the heating system. Hidden problems may exist that are not documented in this report. The inspector is not equipped to inspect furnace heat exchangers for evidence of cracks or holes, as this can only be done by dismantling the unit. This is beyond the scope of this inspection. Some furnaces are designed in such a way that inspection is almost impossible. The inspector cannot light pilot lights; the inspector does not test Safety devices.

NOTE: Asbestos materials have been commonly used in heating systems.

Determining the presence of asbestos can ONLY be performed by laboratory testing and is beyond the scope of this inspection. Thermostats are not checked for calibration or timed functions. Adequacy, efficiency or the even distribution of air throughout a building cannot be addressed by a visual inspection. Electronic air cleaners, humidifiers and de-humidifiers are beyond the scope of this inspection. Have these systems evaluated by a qualified individual. The inspector does not perform pressure tests on coolant systems; therefore no representation is made regarding coolant charge or line integrity. Subjective judgment of system capacity is not a part of the inspection. Normal service and maintenance is recommended on a yearly basis. Determining the condition of oil tanks, whether exposed or buried, is beyond the scope of this inspection. Leaking oil tanks represent an environmental hazard, which is sometimes costly to remedy.

A NPNI M D

Closet Heating System ————————————————————————————————————
1. \  \  \  \  \  \  \  \  \  \  \  \  \
2. XIIII Type Forced air
3. Area Served: Whole Building Approximate Age: 2005
4. Fuel Type: Gas
5. <b>\Bigcup</b> Filter: Disposable filter
6. Distribution: Duct work
7. 🔲 🗌 🔲 Flue Pipe: Metal
8. 🔲 🔲 🔲 Thermostats: Programmable
9. Tank Location: N/A
Plumbing
Water heater tested for functional operation at time of inspection only. No life expectancy is expressed or implied. Approx. 200 gallons of water was pushed through sewer drain lines to verify functional drainage of public sewer or septic system. Water conditioning/filtering systems are not within the scope of this inspection. Water quality or hazardous materials (i.e. lead) testing is outside of scope of a home inspection. All underground piping related to water supply, waste, or sprinkler use are outside of scope this inspection. Leakage or corrosion in underground piping cannot be detected by a visual inspection.
A NPNI M D
1. Service Line: Metal
2. Mater Shut Off: Closet
3. Mater Lines: Plastic
4. Drain Pipes: Plastic
5. Vent Pipes: Plastic

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 13 of 22



Plumbing (Continued)
6.  Fuel Lines: Corrugated Stainless Steel Tubing (CSST) - The state requires that bonding for CSST gas line be evaluated by licensed master electrician
7. Sprinklers: Present 8. Sprinklers: Present 9. Radon Mitigation: Passive Closet Water Heater
10. 🔲 🗌 🔲 Water Heater Operation: Functional
<ul> <li>11. Type: Gas Capacity: 75 Gal.</li> <li>12. Approximate Age: 2014 Area Served: Whole Building</li> <li>13. \square\square\left[ \square\right] = \square\right] Flue Pipe: Metal</li> <li>14. \square\square\square\right] = \square\right] TPRV and Drain Tube: Plastic</li> </ul>
Structure
Areas hidden from view by finished walls or stored items cannot be judged and are not a part of this inspection. Minor cracks are typical in
many foundations and most do not represent a structural problem. If major cracks are present along with bowing, we routinely
recommend further evaluation be made by a qualified structural engineer. All exterior grades should allow for surface and roof water to flow away
from the foundation. All concrete floor slabs experience some degree of cracking due to shrinkage in the drying process. In most instances
floor coverings prevent recognition of cracks or settlement in all but the most severe cases. Where carpeting and other floor coverings are installed, the materials and condition of the flooring underneath cannot be determined.
A NPNI M D
1. Structure Type: Wood frame 2. Differential Movement: Not Present 4. Differential Movement: Not Present 5. Differential Movement: Not Present 6. Differential Movement: Not Present 7. Differential Movement: Not Present 8. Differential Movement: Not Present 9.
9. Subfloor: Wood

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 14 of 22



Laundry Room/Area

Inspection does not cover any damage concealed by rugs, carpeting, wall paneling, furniture or fixtures. Typical wall/ceiling minor cracks/touch ups are considered normal and are not listed in report. Appliances that are listed are the most common found in kitchen and laundry areas. The appliances are tested for basic operation only. Temperatures, thermostats, timers, lights, self cleaning cycle, ice maker, defrost cycle, etc--- are not tested as part of a home inspection. Any appliance that is being conveyed as part of the purchase transaction of the house should be tested at the final walk through. The appliances estimated for replacement probability, based on age and condition, should be budgeted for replacement in the short term. This is not a guarantee or warranty; it is a "best guess" opinion of expected life. However, it should be clearly understood that all appliances are mechanical systems that can fail at any time, regardless any indicated probability and age.

A NPNI M D

1st Fl	oor L	.aun	dry Room/Area
1.			Closet:
2. 🛛			Ceiling: Paint
3. 🛛			Walls: Paint
4. 🛛			Floor: Vinyl
5. 🔀			Doors: Wood
6. 🗌			Windows:
7. 🔀			Electrical: Light(s) and Outlet(s)
8			
9			HVAC Source:
10.			Laundry Tub:
11. 🔀	==	╧	Washer Hose Bib: Present
12. 🔀	==	<u> </u>	☐ Washer and Dryer Electrical: 120-240 VAC
13.	<u> </u>	<u> </u>	Dryer Vent: Rigid metal, Metal flex
14.		<u> </u>	Dryer Gas Line:
15.		<u> </u>	Washer Drain: Wall mounted drain
16			☐ Floor Drain:
Kito	chei	n	
Applia cover consid inspect	inces a any da dered r ction. N ons, cl	are te amag norm No op ocks	ested for functional operation at time of inspection only. No life expectancy is expressed or implied. Inspection does not e concealed by rugs, carpeting, wall paneling, furniture or fixtures. Typical wall/ceiling minor cracks/touch ups are al and are not listed in report. Inspection of stand-alone freezers and built-in ice makers are outside the scope of the binion is offered as to the adequacy of dishwasher operation. Ovens, self or continuous cleaning operations, cooking , timing devices, lights and thermostat accuracy are not tested during this inspection. Appliances are not moved during the ble dishwashers are not inspected, as they require connection to facilitate testing.
Α	NP N	I M	D
2nd F	loor	Kitcl	nen <del></del>
1. 🛛			Closet: Present
2. 🛛			Ceiling: Paint
3. 🛛			Walls: Paint
4. 🛛			Floor: Tile
5. 🗙			Doors: Wood, Metal

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 15 of 22



Kitchen (Continued)
6. \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \
Dishwasher: Present - Dishwasher is leaking and discharging through airgap. A qualified contractor is recommended to evaluate and estimate repairs
12. \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \
Fireplace/Stove
All fireplaces should be cleaned and inspected on a regular basis to make sure that no cracks have developed. Large fires in the firebox can overheat the firebox and flue liners, sometimes resulting in internal damage.  A NPNI M D
Family Room Fireplace  1.
7. Hearth: Present

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 16 of 22



### Garage

Inspection does not cover any damage concealed by rugs, carpeting, wall paneling, furniture or fixtures. Typical wall/ceiling minor cracks/touch ups are considered normal and are not listed in report. The condition of walls behind wall coverings, paneling and furnishings cannot be evaluated. Only the general condition of visible portions of floors is included in this inspection. As a general rule, cosmetic deficiencies are considered normal wear and tear and are not reported. Determining the source of odors or like conditions is not a part of this inspection. Floor covering damage or stains may be hidden by furniture. Determining the condition of insulated glass windows is not always possible due to temperature, weather and lighting conditions.

A NPNI M D

Attached Garage -

Garage Doors: Metal

Roof:

Exterior Surface: Vinyl siding

$\mathbf{I}$	J Doors: Metal
	Ceiling: Paint
	Walls: Unpainted Drywall
	Floor/Foundation: Concrete
	Electrical: Master GFCI Outlet, Light(s) and Outlet(s)
	HVAC Components:
	Windows:
	Gutters:
	Downspouts:
	Leader/Extensions:
hroom	
	cover any damage concealed by rugs, carpeting, wall paneling, furniture or fixtures. Typical wall/ceiling minor
s/touch ups ar	e considered normal and are not listed in report. Shower pans are visually checked for leakage, but leaks often do not
	the shower is in use. Determining whether shower pans, tub/shower surrounds are watertight is beyond the scope of this important to maintain all grouting and caulking in the bath areas. Very minor imperfections can allow water to get into
	as and cause damage. Proper ongoing maintenance will be required in the future.
	ao ama baabb aannager i repor engemg mannenames min ao requires m ano ratan en
NDNI M D	
NPNI M D	
NPNI M D	
	Bathroom ———————————————————————————————————
	Bathroom Ceiling: Paint Walls: Paint Floor: Wood Doors: Wood
	Bathroom Ceiling: Paint Walls: Paint Floor: Wood Doors: Wood Windows:
	Bathroom  Ceiling: Paint  Walls: Paint  Floor: Wood  Doors: Wood  Windows:  Electrical: Light(s) and Outlet(s)
	Ceiling: Paint  Walls: Paint  Floor: Wood  Doors: Wood  Windows:  Electrical: Light(s) and Outlet(s)  Counter/Cabinet:
	Bathroom  Ceiling: Paint  Walls: Paint  Floor: Wood  Doors: Wood  Windows:  Electrical: Light(s) and Outlet(s)
	touch ups ar except when the tion. It is very

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 17 of 22



B	atl	nro	C	on	ገ (	(Continued)
11.	X	П		П		HVAC Source: Present
12.	=	==		同		Ventilation: Present
Sec	con	d F	loc	r E	Bat l	hroom <del></del>
13.		$\boxtimes$				
14.	冈					Ceiling: Paint
15.						Walls: Paint
16.	_					Floor: Wood
17.						Doors: Wood
18.		Øĺ				Windows:
19.	$\boxtimes$					Electrical: Light(s) and Outlet(s)
20.		$\boxtimes$ [				Counter/Cabinet:
21.	$\boxtimes$					Sink/Basin: Single Bowl
22.		$\boxtimes$ [				Tub:
23.		$\boxtimes$ [				Shower:
24.	$\boxtimes$					Toilets: Present
25.	$\boxtimes$					HVAC Source: Present
26.	$\boxtimes$					Ventilation: Present
Ma	ste	r Be	edr	00	m	Bathroom
27.		$\boxtimes$ [				
28.						Ceiling: Paint
29.	$\boxtimes$					Walls: Paint
30.						Floor: Tile
31.	$\boxtimes$					Doors: Wood
32.	=	==				Windows: Vinyl
33.						Electrical: Master GFCI Outlet
34.	=					Counter/Cabinet: Present
35.	_					Sink/Basin: Double Bowl
36.						Tub: Present
37.				X		Shower: Present - Door sticks when trying to open/close. Recommend
						adjustment

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 18 of 22



Bathroom (Continued)
38. Toilets: Present - The tank is loose, recommend securing to prevent movement
39. XIIII HVAC Source: Present 40. XIIII Ventilation: Present
Third Floor Hallway Bathroom ———————————————————————————————————
41. □⊠□□□
42. 🗖 🗌 🔲 Ceiling: Paint
43. 🔲 🔲 🔲 Walls: Paint
44. DDDD Floor: Vinyl
45. Doors: Wood
46.
48. XIII Counter/Cabinet: Present
49. 🔲 🔲 🔲 Sink/Basin: Single Bowl
50. 🔲 🔲 🔲 Tub: Present
51. XIII Shower: Present
52. 🔀 🔲 🔲 Toilets: Present 53. 🔀 🔲 🔲 HVAC Source: Present
54. XIIII Ventilation: Present
Ventuation: Present
Bedroom
Inspection does not cover any damage concealed by rugs, carpeting, wall paneling, furniture or fixtures. Typical wall/ceiling minor cracks/touch ups are considered normal and are not listed in report.
A NPNI M D
3rd Floor, Left, Front Bedroom —
1. Closet: Present 2. Ceiling: Paint
3. \times \textsquare \textsqu
4. A. Door: Carpet  5. Doors: Wood
6. A Windows: Vinyl
7. Electrical: Outlet(s)
8. Maria HVAC Source: Present
9. Maria Smoke Detector: Present

14:55 January 06, 2018



Happy Homeowner 123 Main St Page 19 of 22

Bedroom (Continued)
3rd Floor, Front, Right Bedroom  10. Closet: Present  11. Ceiling: Paint  12. Walls: Paint - Signs of repair to drywall throughout house. recommend following up with seller.
13. 🔲 🔲 🔲 Floor: Carpet
14. 🔲 🔲 🔲 Doors: Wood
15. 🔲 🗌 🔲 Windows: Vinyl
16. D Electrical: Outlet(s)
17. X HVAC Source: Present
18. \times I I I I I I I I I I I I I I I I I I I
Master Bedroom -
19. 🔲 🔲 🔲 Closet: Present
20. 🔲 🔲 🔲 Ceiling: Paint
21. 🔲 🔲 🔲 Walls: Paint
22. 🔲 🗌 🔲 Floor: Carpet
23. 🔲 🔲 🔲 Doors: Wood
24. 🔲 🔲 🔲 Windows: Vinyl
25. 🔲 🔲 🔲 Electrical: Outlet(s)
26. 🔲 🔲 🔲 HVAC Source: Present
27. Maria Smoke Detector: Present

#### Living Space

Inspection does not cover any damage concealed by rugs, carpeting, wall paneling, furniture or fixtures. Typical wall/ceiling minor cracks/touch ups are considered normal and are not listed in report. The condition of walls behind wall coverings, paneling and furnishings cannot be judged. Only the general condition of visible portions of floors is included in this inspection. As a general rule, cosmetic deficiencies are considered normal wear and tear and are not reported. Determining the source of odors or like conditions is not a part of this inspection. Floor covering damage or stains may be hidden by furniture. Determining the condition of insulated glass windows is not always possible due to temperature, weather and lighting conditions. Check with owners for further information. All fireplaces should be cleaned and

inspected on a regular basis to make sure that no cracks have developed. Large fires in the firebox can overheat the firebox and flue liners, sometimes resulting in internal damage.

A NPNI M D

1st Floor, Family Room Living Space -	
1. Closet: Present	
2. Ceiling: Paint	

14:55 January 06, 2018



Happy Homeowner 123 Main St Page 20 of 22

Livina	Snac	ce (Continued)
		· · · · · · · · · · · · · · · · · · ·
3.	ᆜ닏닏	Walls: Paint
4.		Floor: Carpet
5		Doors: Wood - Replace missing door stop
. 🖂 🗀 С		
6.	ᆜ닏닏	Windows: Vinyl
7.	ᆜ닏닏	Electrical: Light(s) and Outlet(s)
8.	ᆜ닏닏	HVAC Source: Present
9. ∐ <b>⊠</b> L	سايياب	
	Hallwa' Tomo	y Living Space
10.		Closet: Present
11.		Ceiling: Paint
12.	$\dashv \vdash \vdash \vdash$	Walls: Paint Floor: Wood
13. <b>□</b> □ □	႕님님	Doors: Wood, Metal
15.		
16.	러버버	Windows: Metal, Wood Electrical: Light(s) and Outlet(s)
17.	러버버	HVAC Source: Present
18.	$\dashv \vdash \vdash \vdash$	Smoke Detector: Present
	LILIL Family	Room Living Space —
19. <b>X</b>		Closet:
20.	커머머	Ceiling: Paint
21.	THH	Walls: Paint
22.	THH	Floor: Wood
23.	THH	Doors: Wood
24.	THH	Windows: Vinyl
25.	ゴ戸戸	Electrical: Outlet(s)
26.	コロロ	HVAC Source: Present
27.	コロロ	
3rd Floor,	Hallwa	y Living Space ————————————————————————————————————
28.		Closet: Present
29.		Ceiling: Paint
30.		Walls: Paint
31.		Floor: Carpet
32.		Doors: Wood
33.		Windows:
34.		Electrical: Light(s) and Outlet(s)
35.		HVAC Source: Present

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 21 of 22



36. Smoke Detector: Present

## Attic

- (i) An inspection is intended to assist in the evaluation of the overall condition of a building. The inspection is based on observation of the visible and apparent condition of the building and its components on the date of the inspection;
- (ii) The results of this home inspection are not intended to make any representation regarding latent or concealed defects that may exist, and no warranty or guaranty is expressed or implied;
- (iii) If your home inspector is not a licensed structural engineer or other professional whose license authorizes the rendering of an opinion as to structural integrity of a building or the condition of its components or systems, you may wish to seek the professional opinion of a licensed structural engineer or other professional regarding any possible defects or other observations set forth in this report; and
- iv) Only home inspections performed by Maryland licensed home inspectors will be recognized as a valid home inspection under a real estate contract.
- (b) The licensee shall give the person or the persons representative the report:
- (1) by the date set in a written agreement by the parties to the home inspection; or
- (2) within 7 business days after the home inspection was performed, if no date was set in a written agreement by the parties to the home inspection.
- (c) Any limitation of the liability of the licensee for any damages resulting from the report on the home inspection shall be agreed to in writing by the parties to the home inspection prior to the performance of the home inspection.

A NPNI M D

Main Attin	
Main Attic	
1. Method	of Inspection: In the attic
2.	Roof Framing: Trusses
3.	☐☐ Sheathing: Wood
4.	☐☐☐ Ventilation: Ridge, Soffit
5.	Insulation: Present
6.	☐☐ Vapor Barrier:
7.	House Fan:

14:55 January 06, 2018

Happy Homeowner 123 Main St Page 22 of 22



